



SMGLR Auto Checks -Pre-Purchase Inspection Report

1. Customer & Vehicle Details

Customer name	CUSTOMER NAME REDACTED
Customer phone / email	CONTACT DETAILS REDACTED
Inspection date and time	03:37 PM (10 GMT)
Inspection location	EXACT INSPECTION LOCATION REDACTED
	COORDINATES REDACTED
Seller / dealer	private
Year / make / model / variant	VEHICLE DETAILS REDACTED
Registration	REGISTRATION REDACTED
VIN	VIN REDACTED
Odometer	ODOMETER REDACTED
Fuel type	Petrol
Transmission	Auto
Service Book	Pass
Inspection package	Essential




SMGLR Auto Checks -Pre-Purchase Inspection Report

Section photos - Customer &
Vehicle Details




SMGLR Auto Checks -Pre-Purchase Inspection Report

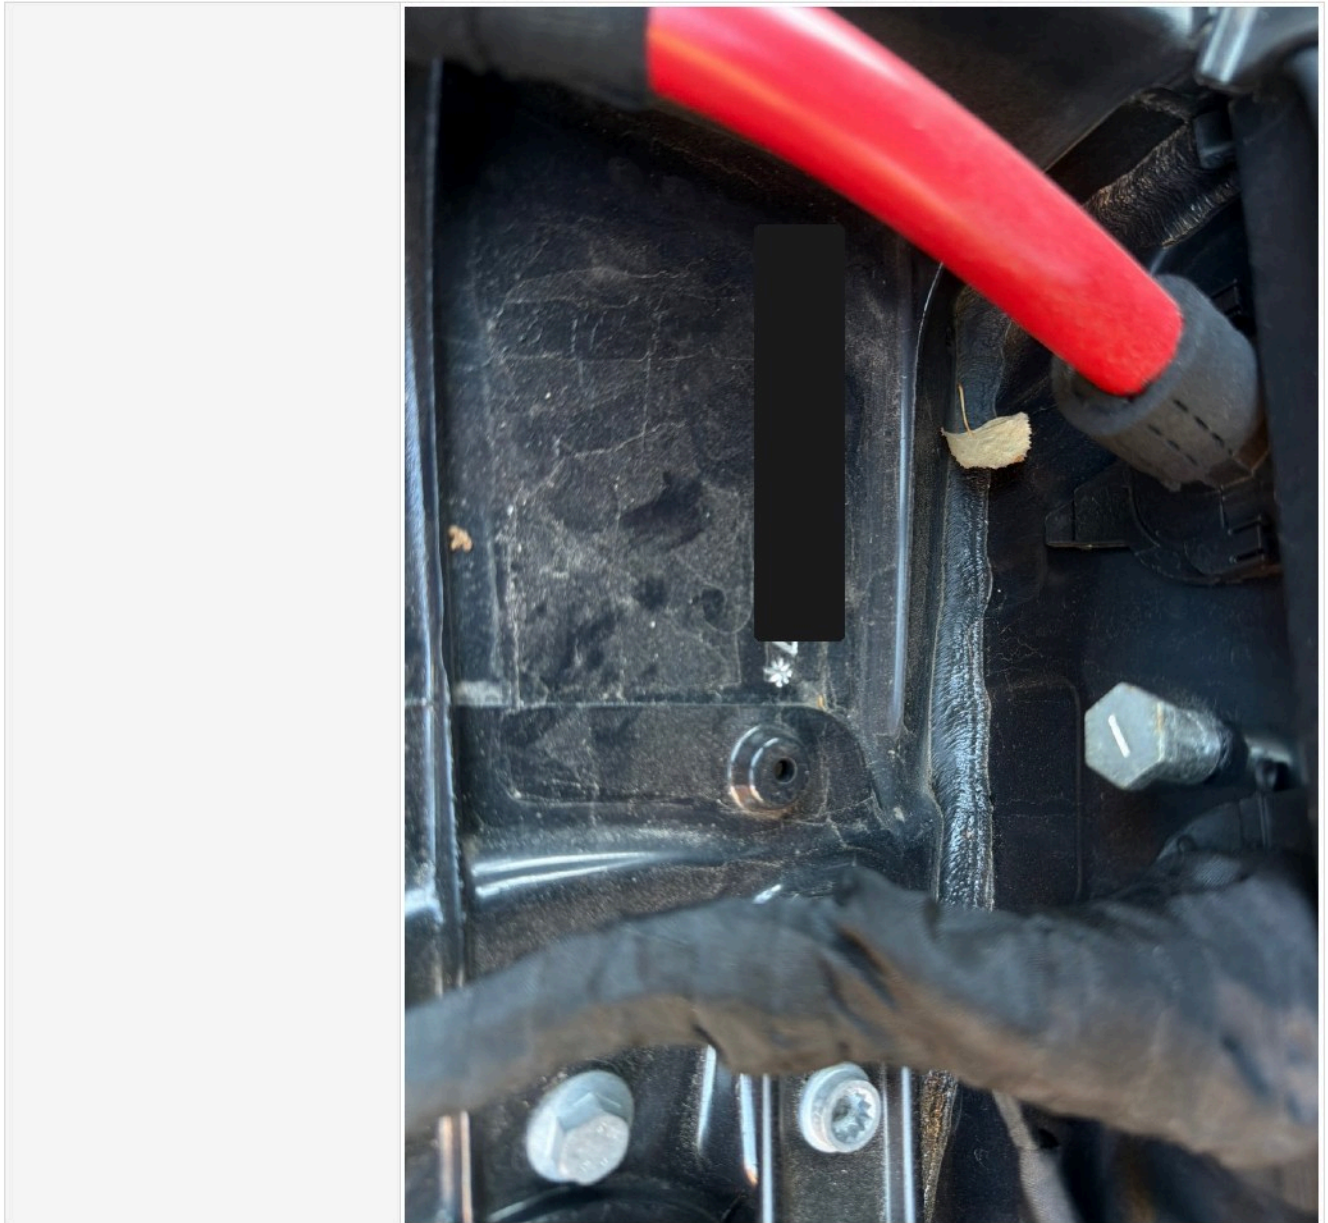



SMGLR Auto Checks -Pre-Purchase Inspection Report

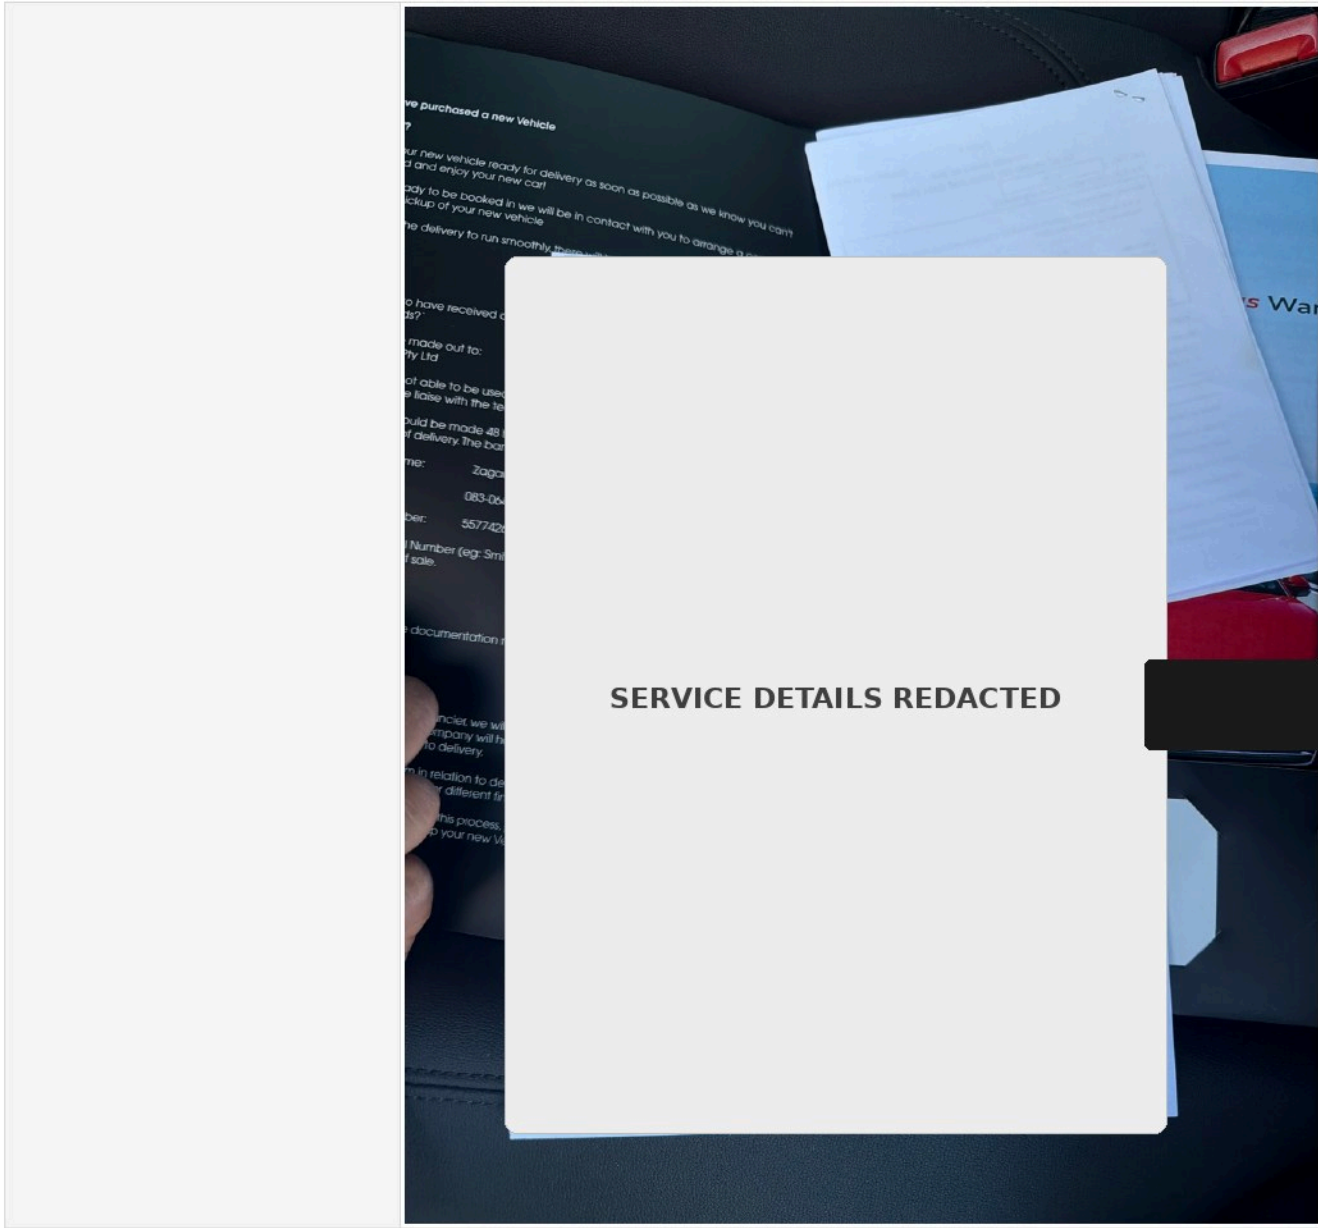



SMGLR Auto Checks -Pre-Purchase Inspection Report

VEHICLE IDENTIFIERS REDACTED

Inspection with oil change			
The current version of the Maintenance Manual must be referred to!			
Change history Maintenance manual: open	☒	☐	☐
Vehicle before the lifting platform			
Horn: check function	☒	☐	☐
Roof insert panorama sliding roof: check function	☒	☐	☐
Dash panel insert: check warning lamps	☒	☐	☐
Glove compartment, interior and reading lighting: check function	☒	☐	☐
Headlights and rear lighting, brake lights, side lights, number plate lighting, turn signals and hazard lights: check function	☒	☐	☐
Windscreen washer system: check spray pattern and adjust as necessary	☒	☐	☐
Windscreen wiper blades: Check for damage	☒	☐	☐
Headlights: check adjustment	☒	☐	☐
Renew cabin filter	☒	☐	☐
Seat belts: Check fitting of latch plate, buckle and the blocking system in the automatic belt retractor	☒	☐	☐
Body: check painted surfaces with open lids and doors and also underneath the vehicle for damage and corrosion	☒	☐	☐
Warning triangle: Check if fitted	☒	☐	☐
First-aid kit: check expiry date and enter (MM/YYYY)	☒	☐	☐
Luggage compartment lighting: check function	☒	☐	☐
Door hinge with separate arrester: clean and lubricate	☒	☐	☐
Water drainage from panoramic sliding roof: check	☒	☐	☐
Emergency battery for telematics: check	☒	☐	☐

Multi Photo Field

2. Road Test & Dynamic Behaviour

Engine power delivery	Pass
Turbo / supercharger response where fitted	
Throttle response	Pass
Transmission upshifts	Pass
Transmission downshifts	Pass
Steering centring and tracking	Pass
Brake pedal feel	Pass



SMGLR Auto Checks -Pre-Purchase Inspection Report

Suspension noise over bumps	Pass
Wheel-bearing noise	Pass
Body rattles and cabin noises	Pass
Cruise control where safe and practical	Pass
Driver-assistance operation where safe	
Operating temperature remains stable	Yes
Warning lights during road test	Yes
Section photos - Road Test & Dynamic Behaviour	
Section notes - Road Test & Dynamic Behaviour	Everything was normal during the rd test no excessive noise recorded.

3. Battery, Cranking & Charging

Battery physical mounting and case condition	Pass
Battery terminals and corrosion	Pass
Battery health / conductance result	Pass
Cranking voltage result	Pass
Start quality	Pass
Charging voltage at idle	Pass




SMGLR Auto Checks -Pre-Purchase Inspection Report

Section photos - Battery, Cranking
& Charging



SMGLR Auto Checks -Pre-Purchase Inspection Report

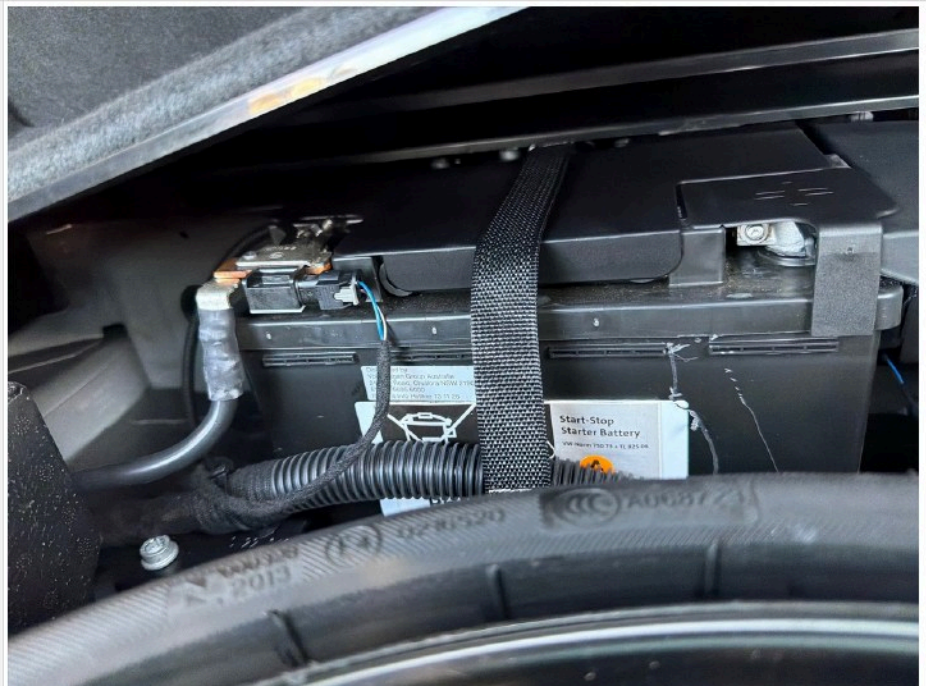

SMGLR Auto Checks -Pre-Purchase Inspection Report



Section notes - Battery, Cranking & Charging

Engine battery and charging system is good. Passed the test.

4. Engine Bay & Fluids

Engine oil level	Perfect
Engine oil condition	Pass
Coolant level	Pass
Coolant condition and contamination	Pass



SMGLR Auto Checks -Pre-Purchase Inspection Report

Cooling-system visible leaks	Pass
Engine oil visible leaks	Pass
Transmission / driveline visible leaks from above	Pass
Brake fluid level and condition	
Power-steering fluid where applicable	
Belts visible condition	Normal
Engine mounts visible condition	
Intake ducting and air box	Pass
Turbocharger / charge-pipe visible condition where fitted	N/A
Evidence of pressure washing or fresh cleaning	No
Cold engine status verified where possible	Yes
Section photos - Engine Bay & Fluids	
Section notes - Engine Bay & Fluids	All the fluid levels were on point. No leaks detected around Engine bay.


5. Exterior, Body & Paint

Bonnet condition and alignment	Pass
Front bumper and grille	
Panel gaps and shut lines	
Paint-depth readings across major panels	
Colour-match consistency	
Overspray, masking lines or repair edges	
Structural repair indicators	
Visible rust / structural concerns	
Exterior seals and trims	
Door handles and locks	



SMGLR Auto Checks -Pre-Purchase Inspection Report

Section photos - Exterior, Body & Paint

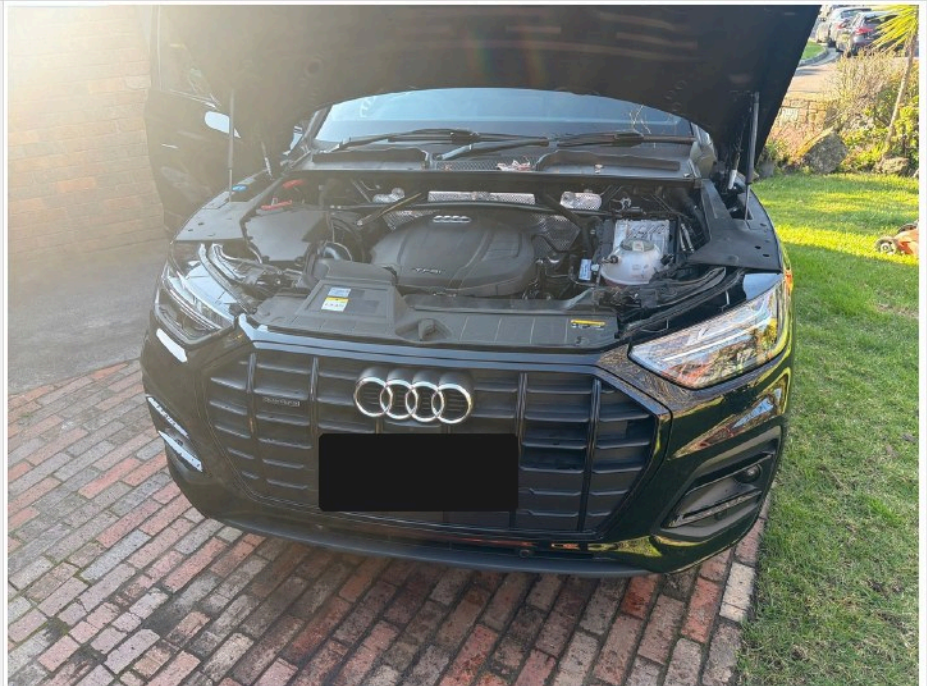



SMGLR Auto Checks -Pre-Purchase Inspection Report





SMGLR Auto Checks -Pre-Purchase Inspection Report





SMGLR Auto Checks -Pre-Purchase Inspection Report





SMGLR Auto Checks -Pre-Purchase Inspection Report





SMGLR Auto Checks -Pre-Purchase Inspection Report





SMGLR Auto Checks -Pre-Purchase Inspection Report



SMGLR Auto Checks -Pre-Purchase Inspection Report





SMGLR Auto Checks -Pre-Purchase Inspection Report





SMGLR Auto Checks -Pre-Purchase Inspection Report



SMGLR Auto Checks -Pre-Purchase Inspection Report

	
	
Section notes - Exterior, Body & Paint	Exterior is decent car do scratches all around the body please check photos.

6. Wheels, Tyres & Visible Brakes

Left-front tyre tread depth measured	Yes
Right-front tyre tread depth measured	Yes
Left-rear tyre tread depth measured	Yes



SMGLR Auto Checks -Pre-Purchase Inspection Report

Right-rear tyre tread depth measured	Yes
Tyre sidewalls free of damage	Pass
Spare tyre or mobility kit	Yes
Wheel condition - left front	
Wheel condition - right front	Pass
Wheel condition - left rear	Pass
Wheel condition - right rear	Pass
Wheel nuts / lock key present	Yes
Front brake rotor/pad visible condition	Pass
Rear brake rotor/pad visible condition	Pass

SMGLR Auto Checks -Pre-Purchase Inspection Report

Section photos - Wheels, Tyres & Visible Brakes



SMGLR Auto Checks -Pre-Purchase Inspection Report





SMGLR Auto Checks -Pre-Purchase Inspection Report

	
Section notes - Wheels, Tyres & Visible Brakes	All four brake pads are good 4-6 mm All four Tyres are have 60-70% left. All four wheels are pretty clean not many gutter rashes.

7. Interior & Convenience

Cabin general condition	Pass
Driver seat and adjustment	Pass
Passenger seat and adjustment	Pass
Rear seats and folding operation	Pass
Carpets, mats and signs of water entry / moisture	Pass
Headlining condition	Pass
Seatbelts and buckles	Pass
Horn operation	Pass
Steering-wheel controls	Pass
Power windows - all positions	Pass
Central locking and child locks	Pass
Exterior mirror adjustment / folding	Pass
Reverse camera	Pass
Parking sensors	Pass
Air-conditioning vent temperature	Pass
Heating operation	Pass



SMGLR Auto Checks -Pre-Purchase Inspection Report


Blower speeds and vent direction	Pass
Demisters front and rear	Pass
Tailgate release and power operation	Pass
Sunroof Operation And condition	PASS
Section photos - Interior & Convenience	
Section notes - Interior & Convenience	Car interior is very clean and everything works perfectly fine. Full interior video has been sent to the customer separately.

8. Diagnostic Scan

Current diagnostic trouble codes	Pass
Stored / historic diagnostic trouble codes	Found
Permanent diagnostic codes	Not found
Engine speed at idle (data)	
Misfire counters / smooth-running values	
DPF soot / regeneration data where applicable	
Odometer values stored in modules	
Scan report or screenshots attached	

SMGLR Auto Checks -Pre-Purchase Inspection Report

Section photos - Diagnostic Scan

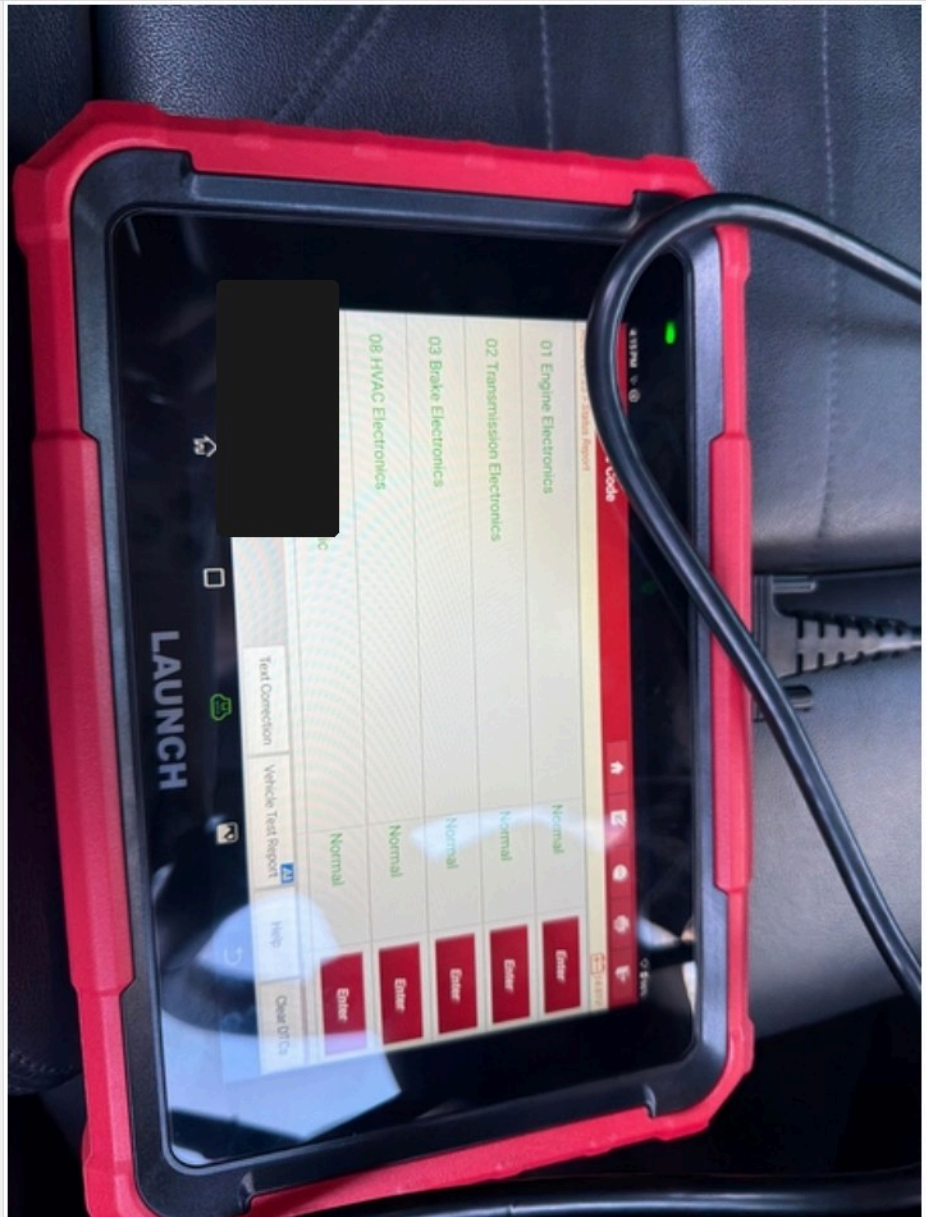

Section notes - Diagnostic Scan

No active fault codes found.

9. Underbody & Exhaust

Rear underbody panels	Pass
Front suspension components	Pass
Rear Suspension components	Pass
Steering Rack	Pass
Visible rust / corrosion underneath	Yes
Exhaust system condition	
Engine lower-area leaks (underbody)	Pass




SMGLR Auto Checks -Pre-Purchase Inspection Report

Signs of impact, grounding or off-road damage	Pass
Front Differential	Pass
Rear differential	Pass
Borescope / restricted-access evidence	Pass
Section photos - Underbody & Exhaust	
	


SMGLR Auto Checks -Pre-Purchase Inspection Report




SMGLR Auto Checks -Pre-Purchase Inspection Report

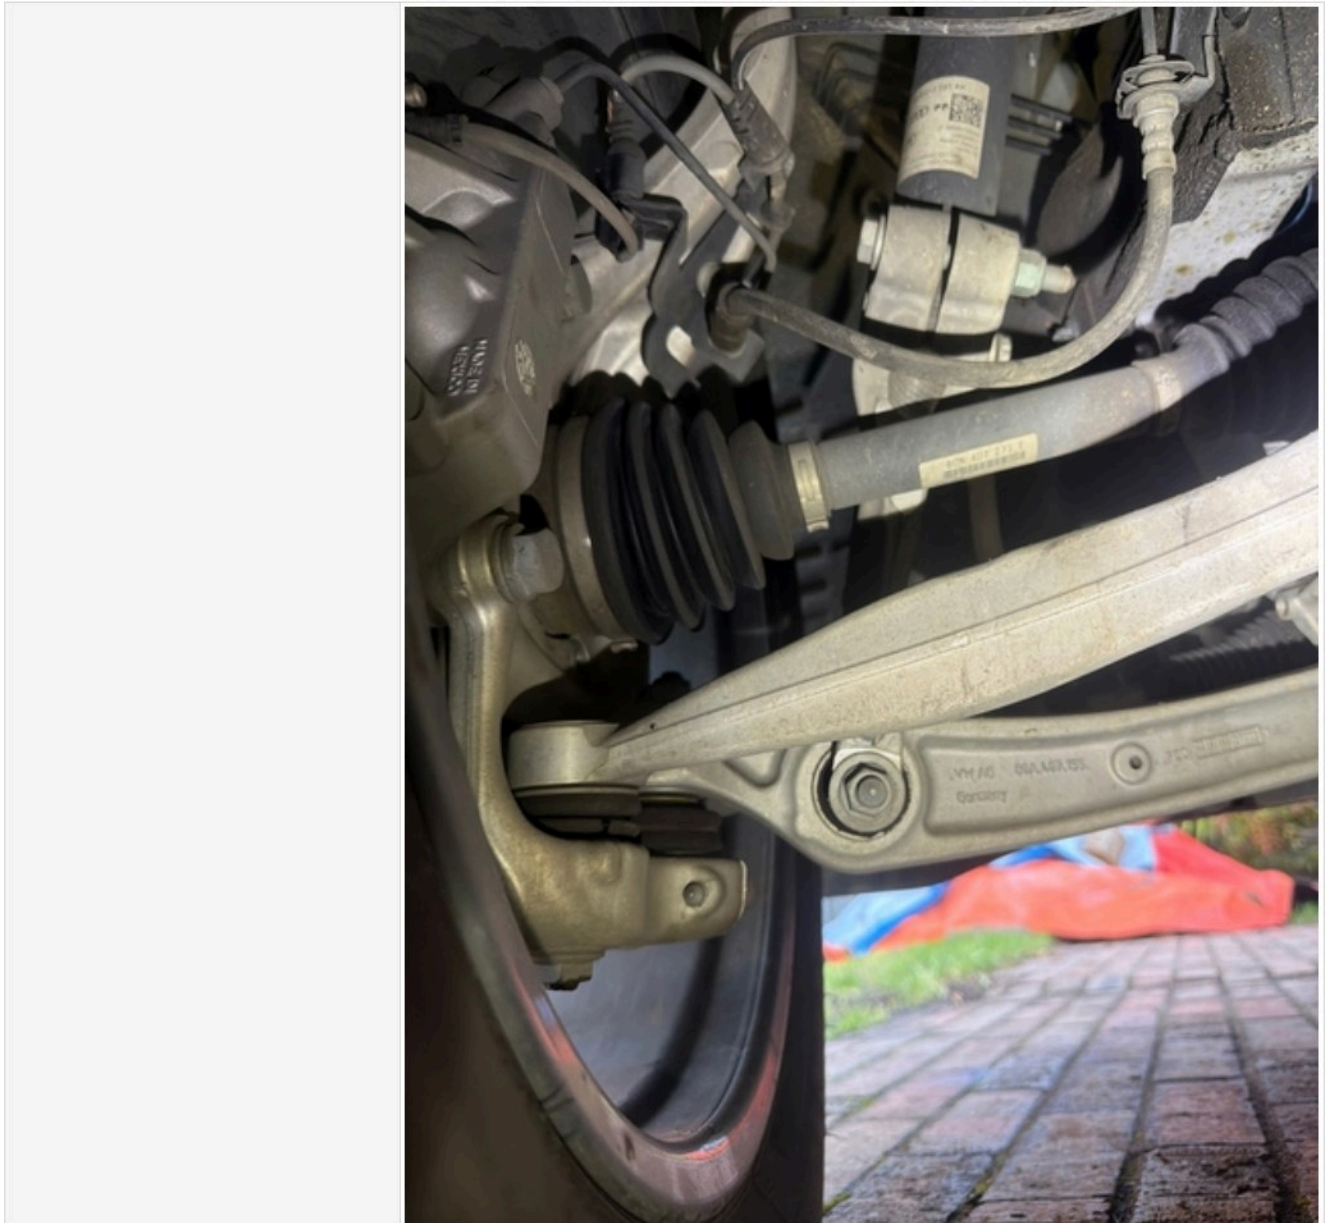

SMGLR Auto Checks -Pre-Purchase Inspection Report

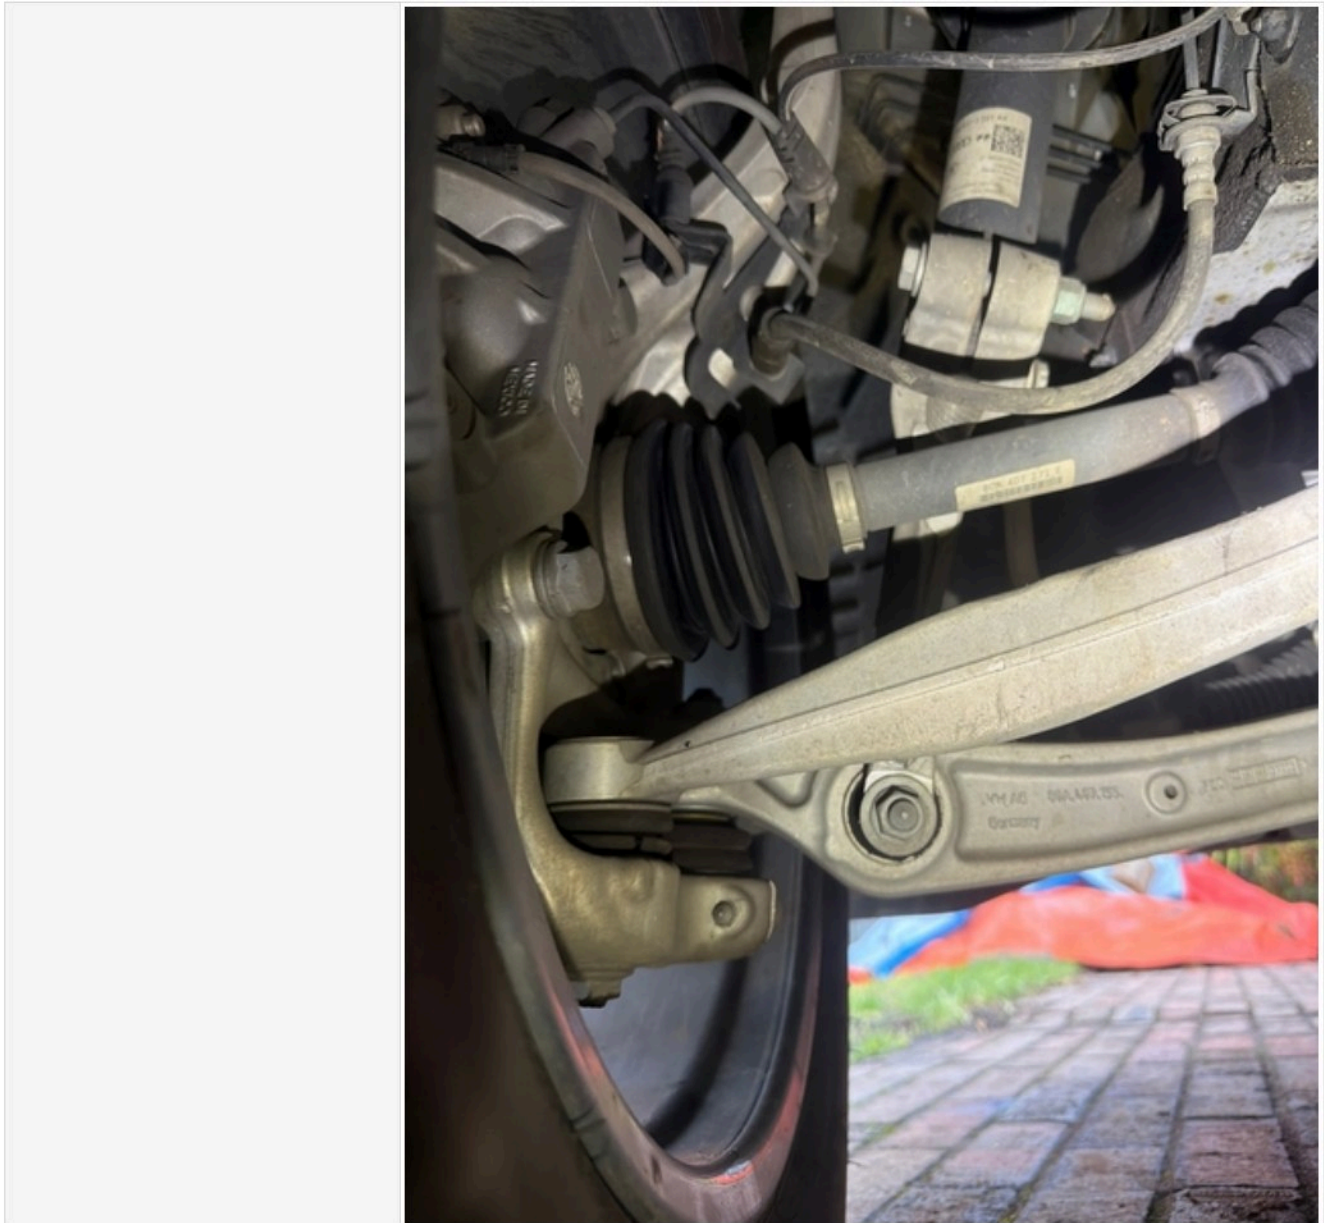

SMGLR Auto Checks -Pre-Purchase Inspection Report

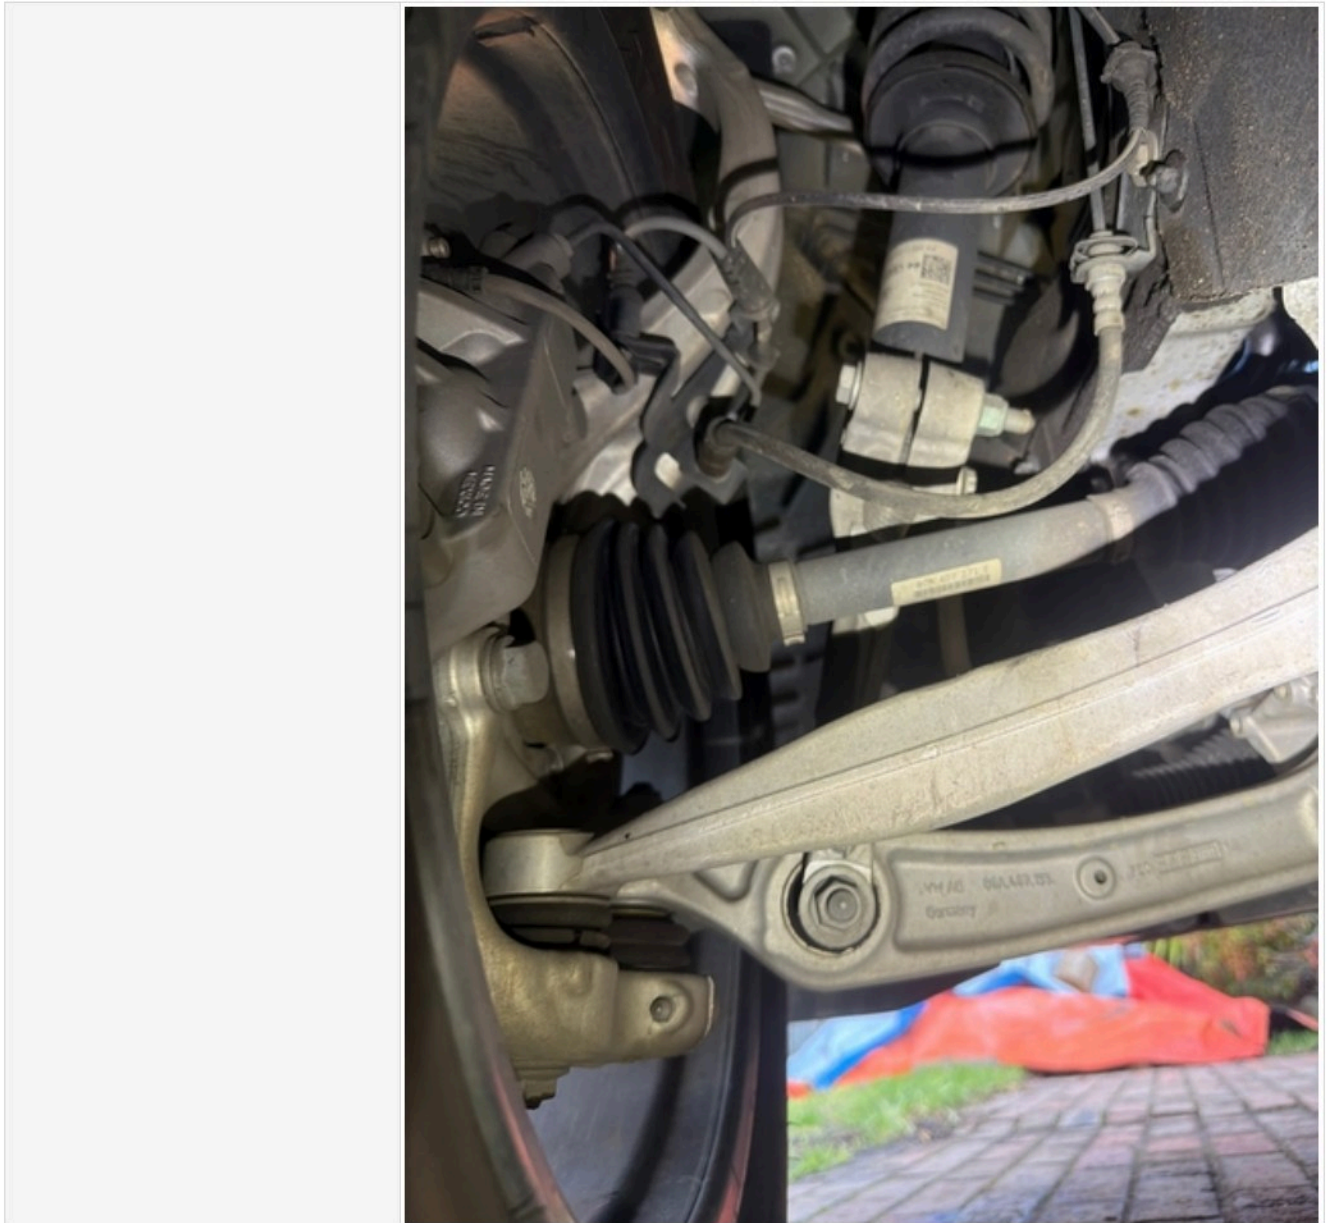

SMGLR Auto Checks -Pre-Purchase Inspection Report



SMGLR Auto Checks -Pre-Purchase Inspection Report

	
Section notes - Underbody & Exhaust	Car had an under tray. Borescope has been used to check for the active oil leaks. At the time of the inspection no active leak has been found. Rear differential left hand axle had oil residue around it but no active leak.

10. Overall Inspection Summary

Overall condition observed	Car is in very good condition. It does have few scratches and panel marks but mechanical no issues were found at the time of the inspection.
Items not assessed / inspection limitations	
Inspection completion date / time	04:42 PM (10 GMT)
Section photos - Overall Summary	

11. Disclaimer



SMGLR Auto Checks -Pre-Purchase Inspection Report

Disclaimer- This report reflects the condition of the vehicle at the time of inspection only and is based on a visual, operational and diagnostic assessment of reasonably accessible components. No dismantling or invasive testing is performed. Accordingly, hidden, internal, intermittent or developing faults may not be detectable at the time of inspection. Photographic evidence is provided throughout the report for the sections inspected, forming part of the inspection record and providing transparency between SMGLR Auto Checks and the customer regarding the condition observed at the time of inspection. Photographs are intended to support the inspector's findings and should be considered together with the written comments and overall assessment. This report is not a Roadworthy Certificate, mechanical warranty, guarantee of future reliability or guarantee that the vehicle is free from defects. Any comments regarding repairs, component condition, remaining service life or repair costs are professional opinions and estimates only. The purchaser remains responsible for the final decision to purchase or operate the vehicle. To the maximum extent permitted by law, SMGLR Auto Checks accepts no liability for faults or defects that could not reasonably have been identified within the scope and circumstances of the inspection. Nothing in this disclaimer excludes or limits any rights or remedies that cannot lawfully be excluded under the Australian Consumer Law.